



# Hydraulická šroubení

ostatní šroubení, příslušenství

Redukce s trubkovými závity, s o-kroužkem							
Obj. č.		Tlak PN (bar)	Vnitř. závit G2	Vněj. závit G1	Délka L	Délka i	SW S
ocel	nerez						
RIW-1838	RIWX-1838	630	G 1/8"	G 3/8"	22,5	12	22
RIW-1412	RIWX-1412	630	G 1/4"	G 1/2"	24	14	27
RIW-1434	RIWX-1434	400	G 1/4"	G 3/4"	26	16	32
RIW-3834	RIWX-3834	400	G 3/8"	G 3/4"	26	16	32
RIW-1210	RIWX-1210	400	G 1/2"	G 1"	29	18	41
RIW-1254	RIWX-1254	400	G 1/2"	G 1 1/4"	32	20	50
RIW-3454	RIWX-3454	400	G 3/4"	G 1 1/4"	32	20	50
RIW-3415	RIWX-3415	315	G 3/4"	G 1 1/2"	36	22	55
RIW-1015	RIWX-1015	315	G 1"	G 1 1/2"	36	22	55

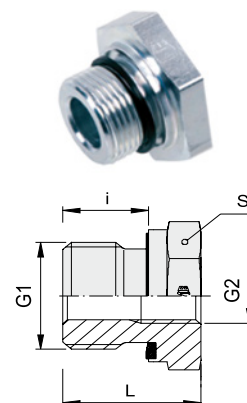

Redukce s trubkovými závity, s o-kroužkem							
Obj. č.		Tlak PN (bar)	Vněj. závit G1	Vnitř. závit G2	Délka L	Délka i	SW S
ocel	nerez						
RIAW-1814	RIAWX-1814	630	G 1/8"	G 1/4"	31	8	19
RIAW-1838	RIAWX-1838	630	G 1/8"	G 3/8"	32	8	24
RIAW-1418	RIAWX-1418	630	G 1/4"	G 1/8"	29	12	19
RIAW-1438	RIAWX-1438	630	G 1/4"	G 3/8"	36	12	24
RIAW-1412	RIAWX-1412	630	G 1/4"	G 1/2"	40	12	30
RIAW-1434	RIAWX-1434	630	G 1/4"	G 3/4"	43	12	36
RIAW-3814	RIAWX-3814	630	G 3/8"	G 1/4"	36	12	22
RIAW-3812	RIAWX-3812	630	G 3/8"	G 1/2"	41	12	30
RIAW-3834	RIAWX-3834	400	G 3/8"	G 3/4"	44	12	36
RIAW-1238	RIAWX-1238	630	G 1/2"	G 3/8"	37	14	27
RIAW-1234	RIAWX-1234	400	G 1/2"	G 3/4"	46	14	36
RIAW-1210	RIAWX-1210	400	G 1/2"	G 1"	49	14	41
RIAW-1254	RIAWX-1254	400	G 1/2"	G 1 1/4"	53	14	55
RIAW-3412	RIAWX-3412	400	G 3/4"	G 1/2"	43	16	32
RIAW-3410	RIAWX-3410	400	G 3/4"	G 1"	51	16	41
RIAW-3454	RIAWX-3454	400	G 3/4"	G 1 1/4"	55	16	55
RIAW-3415	RIAWX-3415	315	G 3/4"	G 1 1/2"	57	16	60
RIAW-1034	RIAWX-1034	400	G 1"	G 3/4"	49	18	41
RIAW-1054	RIAWX-1054	400	G 1"	G 1 1/4"	57	18	55
RIAW-1015	RIAWX-1015	315	G 1"	G 1 1/2"	59	18	60
RIAW-5410	RIAWX-5410	400	G 1 1/4"	G 1"	53	20	50
RIAW-5415	RIAWX-5415	315	G 1 1/4"	G 1 1/2"	60	20	60
RIAW-1554	RIAWX-1554	315	G 1 1/2"	G 1 1/4"	58	22	55

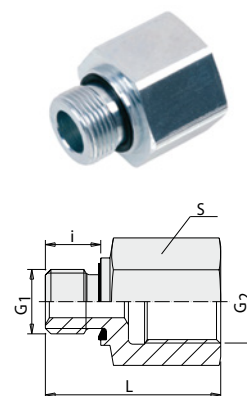

související zboží:

Trubky  
str. 410



Těsnění závitů  
str. 86



Hydraulické adaptéry  
str. 388



Hadice  
str. 479

