


Pájecí tvarovky

z mědi

Nátrubky s vnitřním závitem - typ N2				
Obj. č.	Velikost	a	Za	S
N2-1212	12 mm × 1/2"	26	17	25
N2-1415	15 mm × 1/4"	18	8	20
N2-3815	15 mm × 3/8"	23	12	20
N2-1215	15 mm × 1/2"	32	21	25
N2-3415	15 mm × 3/4"	30	19	30
N2-1218	18 mm × 1/2"	29	16	25
N2-3418	18 mm × 3/4"	32	19	30
N2-1222	22 mm × 1/2"	31	15	25
N2-3422	22 mm × 3/4"	34	18	30
N2-1022	22 mm × 1"	37	21	39
N2-1228	28 mm × 1/2"	35	16	30
N2-3428	28 mm × 3/4"	35	16	30
N2-1028	28 mm × 1"	39	22	37
N2-5428	28 mm × 1 1/4"	43	24	46
N2-3435	35 mm × 3/4"	40	16	30
N2-1035	35 mm × 1"	43	20	37
N2-5435	35 mm × 1 1/4"	48	24	46
N2-1042	42 mm × 1"	48	21	37
N2-5442	42 mm × 1 1/4"	45	18	48
N2-1542	42 mm × 1 1/2"	51	23	55
N2-1554	54 mm × 1 1/2"	50	18	53
N2-2054	54 mm × 2"	60	28	67

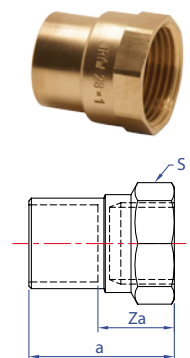

Nátrubky s vnějším závitem - typ N3				
Obj. č.	Velikost	a	Za	S
N3-3812	12 mm × 3/8"	21	12	15
N3-1212	12 mm × 1/2"	26	17	19
N3-1415	15 mm × 1/4"	25	15	19
N3-3815	15 mm × 3/8"	24	13	19
N3-1215	15 mm × 1/2"	26	15	19
N3-3415	15 mm × 3/4"	28	17	19
N3-1218	18 mm × 1/2"	28	15	21
N3-3418	18 mm × 3/4"	28	15	21
N3-1222	22 mm × 1/2"	32	16	25
N3-3422	22 mm × 3/4"	32	17	25
N3-1022	22 mm × 1"	33	17	27
N3-1228	28 mm × 1/2"	36	17	32
N3-3428	28 mm × 3/4"	36	18	32
N3-1028	28 mm × 1"	38	19	32
N3-5428	28 mm × 1 1/4"	39	20	34
N3-1035	35 mm × 1"	43	19	40
N3-5435	35 mm × 1 1/4"	40	17	45
N3-1535	35 mm × 1 1/2"	40	17	40
N3-5442	42 mm × 1 1/4"	50	23	46
N3-1542	42 mm × 1 1/2"	52	25	51
N3-2042	42 mm × 2"	47	20	46
N3-2054	54 mm × 2"	65	31	81

