



Lisovací tvarovky


s M-profilem, z mědi pro plyny

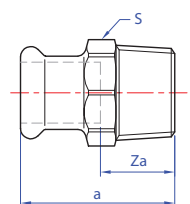

Přechodky s vnějším závitem a lisovacím koncem - typ MG3					
	Obj. č.	Velikost	a	S	Za
o	MG3-1215	15 mm × 1/2"	37	21	17
o	MG3-3415	15 mm × 3/4"	39	25	19
o	MG3-1218	18 mm × 1/2"	37	25	17
o	MG3-3418	18 mm × 3/4"	39	25	19
o	MG3-1222	22 mm × 1/2"	38	30	17
o	MG3-3422	22 mm × 3/4"	40	30	21
o	MG3-1022	22 mm × 1"	42	32	21
o	MG3-3428	28 mm × 3/4"	43	36	20
o	MG3-1028	28 mm × 1"	44	36	21
o	MG3-5428	28 mm × 1 1/4"	48	40	25
o	MG3-1035	35 mm × 1"	48	41	22
o	MG3-5435	35 mm × 1 1/4"	50	41	24
o	MG3-5442	42 mm × 1 1/4"	58	51	28
o	MG3-1542	42 mm × 1 1/2"	58	51	28
o	MG3-2054	54 mm × 2"	63	63	28

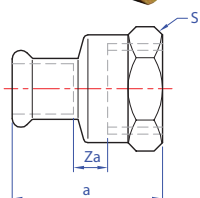

Přechodky s vnitřním závitem a lisovacím koncem - typ MG2					
	Obj. č.	Velikost	a	S	Za
o	MG2-1215	15 mm × 1/2"	38	25	10
o	MG2-3415	15 mm × 3/4"	39	30	9
o	MG2-1218	18 mm × 1/2"	37	25	9
o	MG2-3418	18 mm × 3/4"	39	30	11
o	MG2-1222	22 mm × 1/2"	37	30	8
o	MG2-3422	22 mm × 3/4"	39	30	10
o	MG2-1028	28 mm × 1"	45	37	11
o	MG2-5435	35 mm × 1 1/4"	50	46	12
o	MG2-1542	42 mm × 1 1/2"	54	53	12
o	MG2-2054	54 mm × 2"	63	65	12

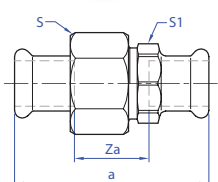

Šroubení s lisovacími konci - typ MG11						
	Obj. č.	Velikost	a	Za	S	S1
o	MG11-15	15 mm	61	21	34	28
o	MG11-28	28 mm	75	29	48	41
o	MG11-35	35 mm	82	30	58	50

související zboží:

Trubky
str. 1160



Těsnění závitů
str. 86



Kohouty
str. 564



Teploměry
str. 650

